



---

An ISO 9001:2000 Registered Company

---

## Gateway<sup>AI</sup> Calibration Update

Document Date: 7/6/2010

Follow these steps to update the Gateway's calibration file:

1. Ensure the vehicle is not running and the key is in the off position.
2. Unplug *all* of the connectors from the Gateway module.
3. Connect one end of the HHP cable to the Merlin connector on Gateway and the other end to the HHP itself.
4. Plug the Data Link connector into the Gateway module to apply power. The Data Link connector is 6-pins and identified with red tape.
5. Watch the LEDs on the HHP module. The green 'Power' LED will illuminate, the green 'TX/RX' light will briefly flash and then the red 'Pass' LED will illuminate for a moment. **When the red 'Pass' LED turns off, disconnect the HHP from the Gateway.**
6. Note that if the HHP remains plugged into the Gateway it will repeat step 5, so it is important to unplug the cable immediately after the red 'Pass' LED turns off.
7. The new calibration is now loaded. Plug the remaining Gateway connectors back into the module, taking care to return them to the correct cavity.